



ENVIRONMENTAL CONSULTANTS

234 W. FLORIDA STREET, FIFTH FLOOR  
MILWAUKEE, WISCONSIN 53204  
(P) 414.837.3607  
(F) 414.837.3608

Report: **Weekly Progress Report**

Project: **Former Two Rivers MGP Site  
Removal Action Construction  
Two Rivers, Wisconsin**

Date: December 12, 2014

Prepared By: Natural Resource Technology, Inc.  
Mark D. Walter, PE  
Kenneth R. Mika, PE

Submitted To: Integrys Business Support, LLC  
Naren M. Prasad, PE  
Stacy A. Brault

Activity Period: November 24 through November 30, 2014

---

Natural Resource Technology, Inc. Personnel on Site

- Mark Walter, **Field Engineer**
- Andrea Salus, **Field Engineer**
- Colin Daly, **Field Engineer**
- Kenneth Mika, **Project Manager**
- Todd Lewis, **Construction Manager**

Integrys/Wisconsin Public Service Corporation Personnel on Site

- None

Geo-Solutions, Inc. Personnel on Site

- Keith Adamson
- Aaron Handel
- Eric Shannon
- Jason Greggs
- Rob Kautchick
- Bob Lager
- John Scott
- Jesse Frederick
- Cliff Grass
- Tom Cook
- Stanley Smith

U.S. EPA Personnel on Site

- None

Subcontractors on Site

- Edler Brothers Trucking, Inc., **Trucking Contractor**

Others

- None

Visitors

- None

This report summarizes field activities performed by NRT, GSI, and GSI's subcontractors, on behalf of IBS at the former Two Rivers Former MGP Site Time Critical Removal Action:

**Site Activities**

Removal Action Totals:

- Soil Direct Disposal through 11/30/14: 12,115.43 Tons
- Debris Direct Disposal (Concrete and Wood) through 11/30/14: 1,067.83 Tons
- Asbestos-Wrapped Pipe Direct Disposal through 11/30/14: 12.79 Tons
- Total Direct Disposal through 11/30/14: 13,196.05 Tons
- In-Situ Solidification/Stabilization (ISS) through 11/30/14: 36,177.09 Cubic Yards

Site Perimeter Air Monitoring:

- Real-time site perimeter air monitoring for TVOCs and PM<sub>10</sub> was conducted 24 hours per day, all seven days of the week. The locations of the perimeter air monitoring stations are shown on Figure 1.
- A total of 6 SUMMA canister samples were collected, including one sample at each of the five air monitoring station locations and one duplicate sample. SUMMA canister samples were analyzed for BTEX compounds and naphthalene. A summary of the analytical results is presented in Table 1.
- A total of 6 PUF samples were collected, including one sample at each of the five air monitoring station locations and one field blank sample. PUF samples were analyzed for PAH compounds. A summary of the analytical results is presented in Table 1.

NRT

- Participated in daily safety meetings to evaluate potential safety concerns for the day's planned construction activities.
- Oversaw GSI's excavation of peat material in the ISS Area.
- Oversaw GSI's preparation of an ISS work pad.
- Oversaw GSI's ISS drilling.
- Collected and prepared two ISS Construction Quality Assurance (CQA) samples (ISS-CM31-B and ISS-CL26-M).
- Received and reviewed ISS CQA sample test results for UCS and hydraulic conductivity. Results are compared to ISS performance goals established in the Removal Action Work Plan (RAWP) Addendum 1 Construction Quality Assurance Project Plan (CQAPP).

- Oversaw GSI's management of ponded water.
- Oversaw GSI's weekly erosion control inspection on Tuesday (11/25).
- Issued truck manifests for disposal of peat material and concrete debris.
- Performed perimeter air monitoring and sampling.
- Monitored site conditions for traffic flow, fugitive dust, odors, and general overall safety.

#### Geo-Solutions Inc.

- Continued excavation of peat material in the ISS Area.
- Continued constructing an ISS work pad.
- Continued full-scale ISS drilling.
- Managed ponded water by pumping to a frac tank. Water pumped to the frac tank is intended to be used for ISS grout production.
- Continued off-site trucking and disposal of peat material and concrete debris.
- Performed weekly erosion control inspection on Tuesday (11/25).
- Implemented fugitive emission controls, including covering of inactive stockpiles, operation of an odor control perimeter misting system, and sequencing of work to minimize material handling.
- Conducted periodic worker health and safety air monitoring in the work (exclusion) zone.

#### Changes to Scope of Work

- None.

#### Open/Outstanding Items

- None.

#### Work planned for the week of December 1 through December 7, 2014

- Wisconsin Public Service (WPS) to weld valves on asbestos-wrapped abandoned gas pipeline for grouting by Schroeder Environmental Cleaning Services, Inc. (SECSI).
- Continue to excavate peat material in the ISS Area.
- Continue off-site trucking and disposal of peat material.
- Continue construction of an ISS work pad.
- Continue full-scale ISS.
- Continue ISS CQA sampling.
- Continue excavation and placement of filter fabric and stone backfill in the Excavation Area.
- Continue Excavation Area limit sampling.
- Continue perimeter air monitoring and sampling.
- Continue implementation of fugitive emission controls.

A Weekly Progress Report will be issued throughout the duration of field activities for this Time Critical Removal Action. A written report summarizing the results of the Removal Action will be provided following completion of all field activities.

Please contact us if you have any questions.



Sincerely,

NATURAL RESOURCE TECHNOLOGY, INC.

A handwritten signature in black ink that reads "Kenneth R. Mika".

Kenneth R. Mika, PE  
Environmental Engineer

Attachments:

- Field Photos
- Figure 1: Air Monitoring Station Locations
- Table 1: Weekly Air Data Summary

[P:\1500\1569\Construction\Field Reports\Weekly Reports\1569 NRT Two Rivers MGP Weekly Report 11-24-14 To 11-30-14.Docx]



**Field Photos:**



**Photo 1:** ISS drilling and peat removal in ISS Area.

**Direction:** Facing northeast

**Photo Date:** 11/24/2014

**Photo Taken By:** ANS



**Photo 2:** ISS drilling and covering of inactive stockpiles.

**Direction:** Facing northwest

**Photo Date:** 11/25/2014

**Photo Taken By:** ANS






**Photo 3:** ISS drilling and covering of inactive stockpiles.

**Direction:** Facing southwest

**Photo Date:** 11/25/2014

**Photo Taken By:** MDW

Oct 30, 2014 1:33pm PLOTTED BY: rhopkins SAVED BY: rhopkins  
 I:\ACADATA\Projects\15\1569 2riv\1569\_2riv\14-8\1569-148-B01.dwg Layout1  
 XREFS: I:\GIS\Projects\15\1569\CAD\1569\CAD\1569\Manitowoc\_Co\_Imagery\_2010\_v2.tiff  
 XREFS:

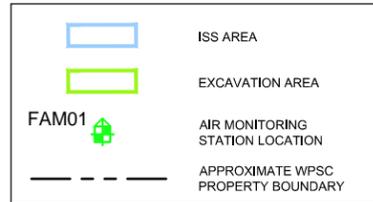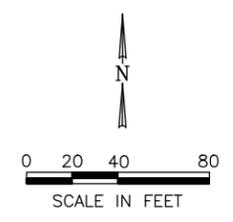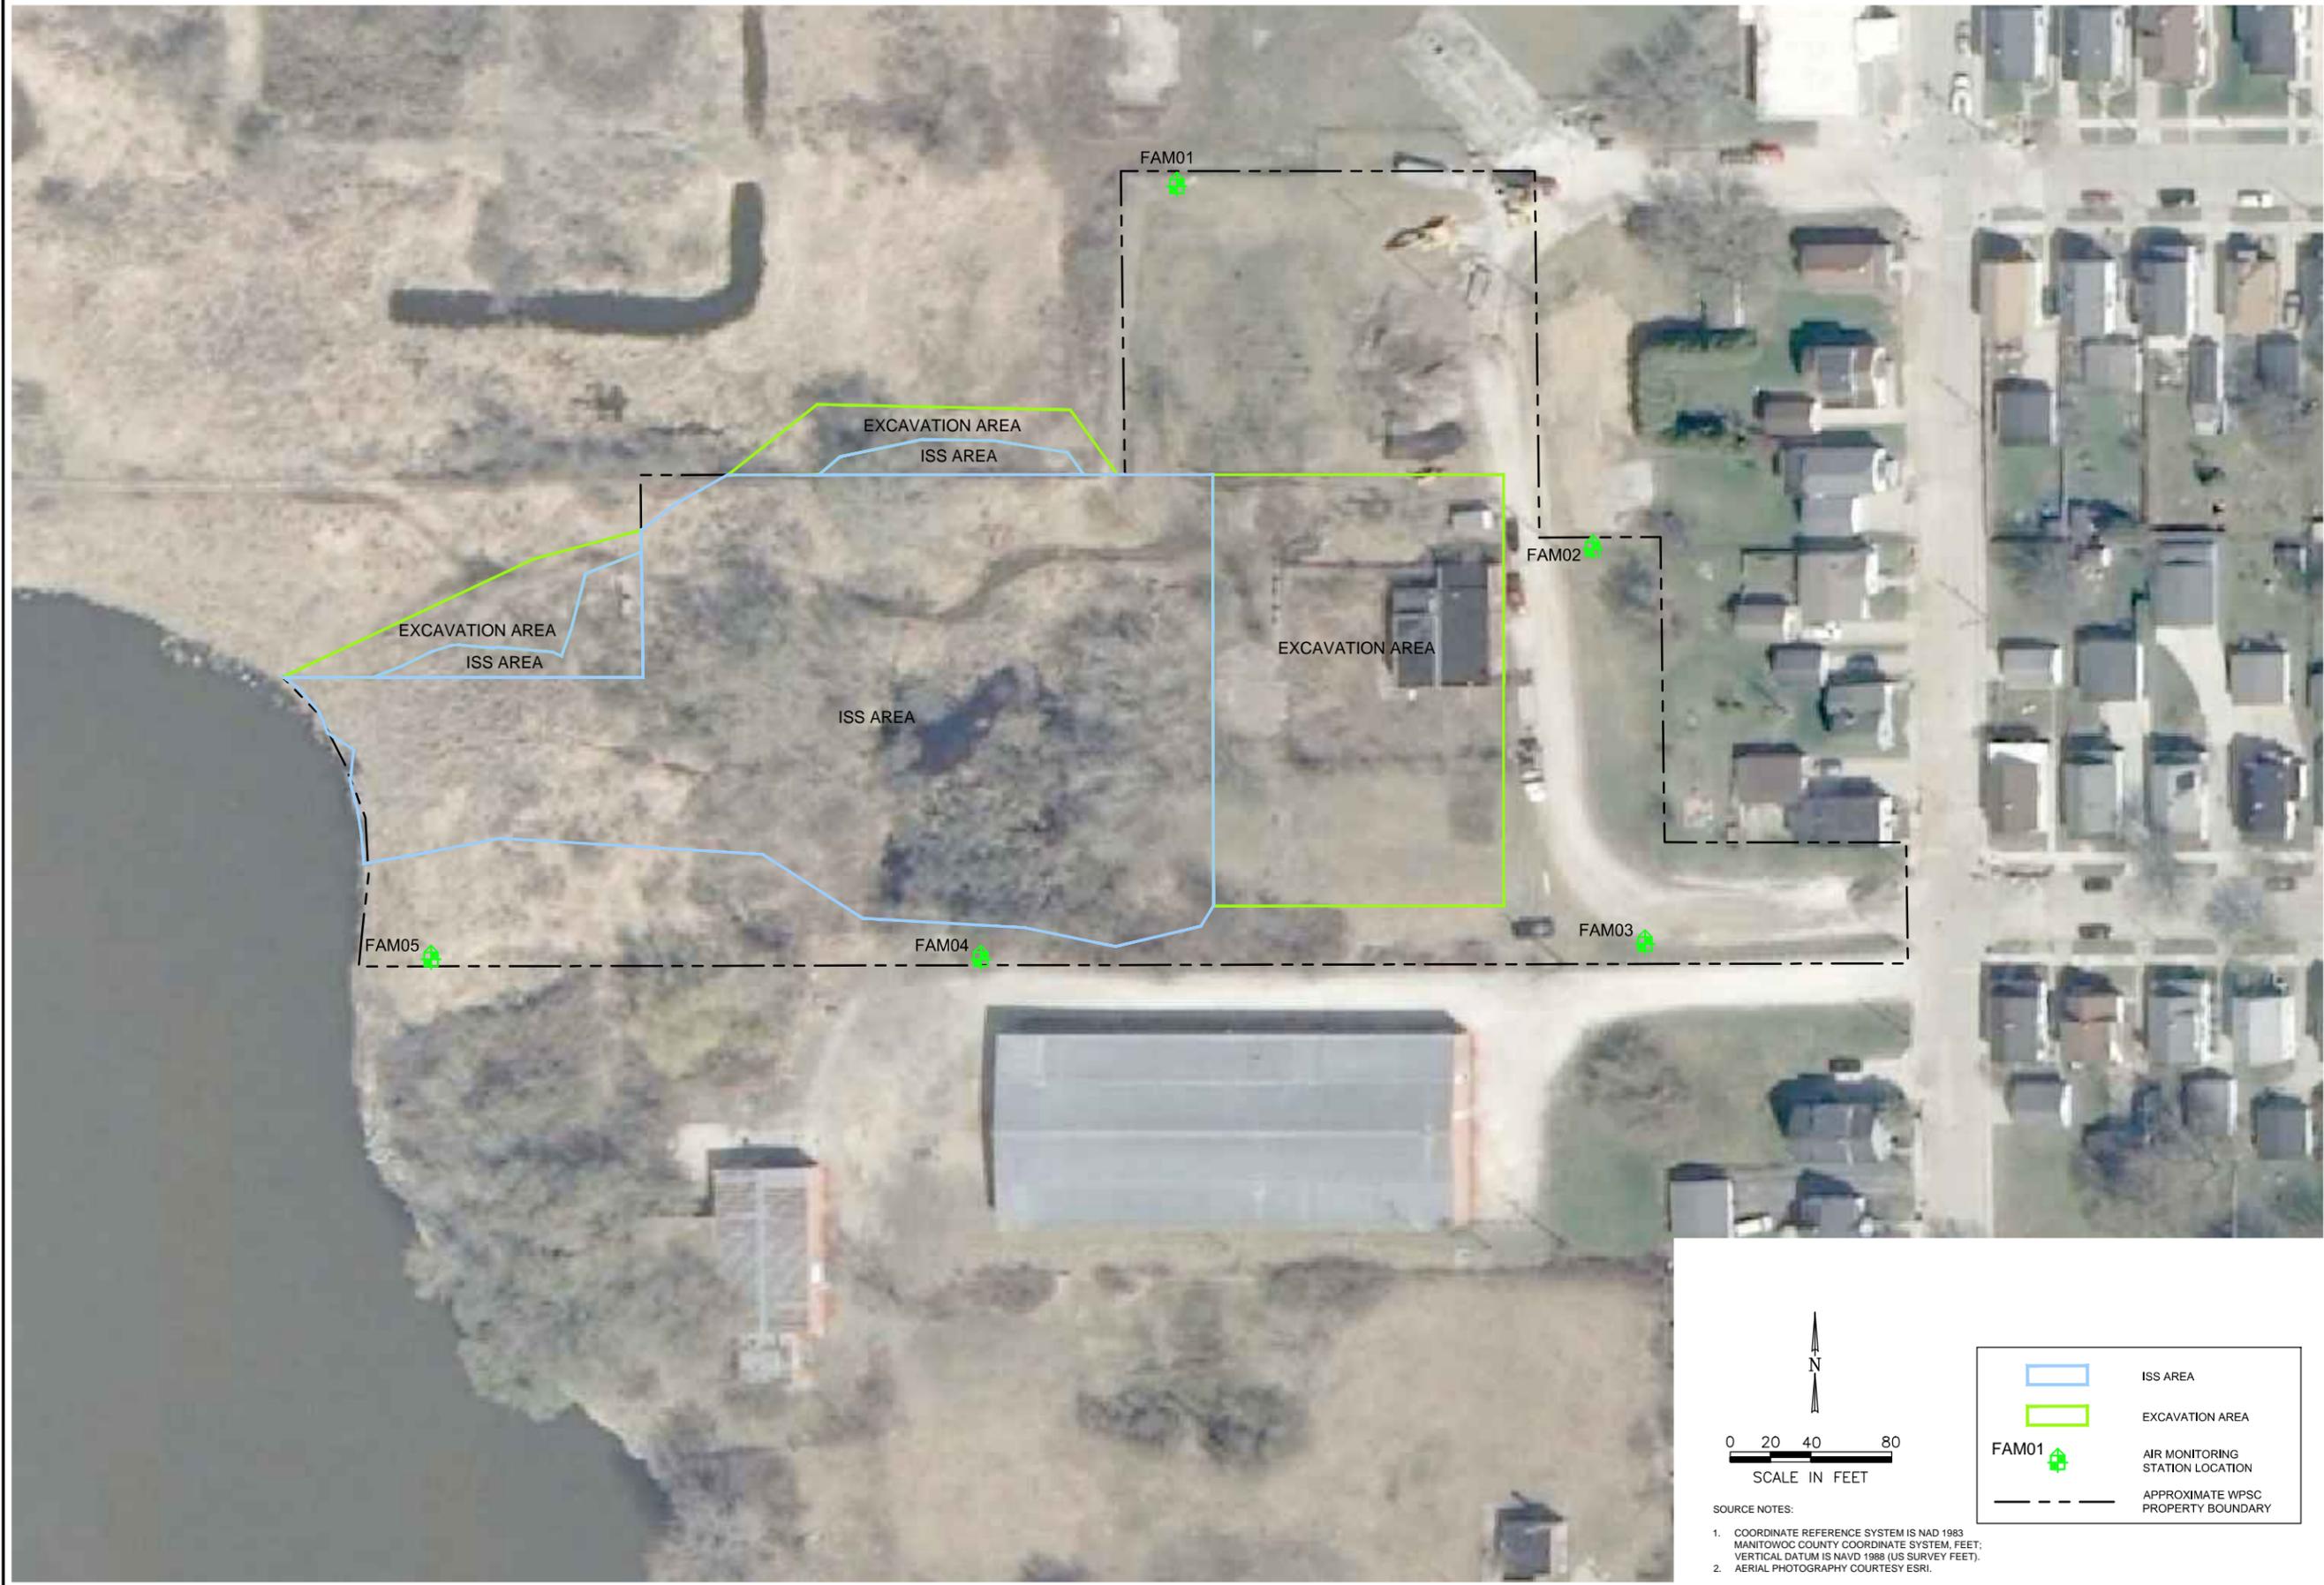

SOURCE NOTES:  
 1. COORDINATE REFERENCE SYSTEM IS NAD 1983  
 MANITOWOC COUNTY COORDINATE SYSTEM, FEET;  
 VERTICAL DATUM IS NAVD 1988 (US SURVEY FEET).  
 2. AERIAL PHOTOGRAPHY COURTESY ESRI.

**AIR MONITORING STATION LOCATIONS**

FORMER TWO RIVERS MANUFACTURED GAS PLANT  
 WISCONSIN PUBLIC SERVICE CORPORATION  
 TWO RIVERS, WISCONSIN



PROJECT NO.  
 1569.1/14.8

FIGURE NO.  
 1

DRAWN BY:	RLH	DATE:	10/30/14
CHECKED BY:	KRM	DATE:	10/30/14
APPROVED BY:	KRM	DATE:	XXX
DRAWING NO: 15691-148-B01			
<b>DRAFT</b>			

**Table 1 - Analytical Air Summary**

**Weekly Progress Report  
Former Two Rivers MGP Site  
Two Rivers, WI**

Sample Location	Sample Date	Sample Type	Benzo(a)anthracene (ug/m3)	Benzo(a)pyrene (ug/m3)	Benzo(b)fluoranthene (ug/m3)	Benzo(k)fluoranthene (ug/m3)	Chrysene (ug/m3)	Dibenz(a,h)anthracene (ug/m3)	Indeno(1,2,3-cd)pyrene (ug/m3)
<b>Site-Specific Air SL (1E-04)</b>			<b>160</b>	<b>16</b>	<b>160</b>	<b>160</b>	<b>1600</b>	<b>15</b>	<b>160</b>
<b>Site-Specific Air SL (1E-05)</b>			<b>16</b>	<b>1.6</b>	<b>16</b>	<b>16</b>	<b>160</b>	<b>1.5</b>	<b>16</b>
<b>Site-Specific Air SL (1E-06)</b>			<b>1.6</b>	<b>0.16</b>	<b>1.6</b>	<b>1.6</b>	<b>16</b>	<b>0.15</b>	<b>1.6</b>
FAM01	11/24/2014	PUF	< 0.0009	< 0.0012	< 0.0013	< 0.0014	< 0.0007	< 0.0015	< 0.0016
FAM02	11/24/2014	PUF	< 0.001	< 0.0012	< 0.0013	< 0.0014	< 0.0007	< 0.0015	< 0.0016
FAM03	11/24/2014	PUF	< 0.001	< 0.0013	< 0.0014	< 0.0014	< 0.0008	< 0.0016	< 0.0016
FAM04	11/24/2014	PUF	< 0.001	< 0.0012	< 0.0013	< 0.0014	< 0.0007	< 0.0016	< 0.0016
FAM05	11/24/2014	PUF	< 0.001	< 0.0013	< 0.0014	< 0.0014	< 0.0008	< 0.0016	< 0.0016
Field Blank	11/24/2014	PUF	< 0.001	< 0.0013	< 0.0014	< 0.0014	< 0.0008	< 0.0016	< 0.0016
<b>Average 9/9/14 - 11/24/14</b>			<b>0.0016</b>	<b>0.0020</b>	<b>0.0012</b>	<b>0.0024</b>	<b>0.0020</b>	<b>0.0017</b>	<b>0.0015</b>

Sample Location	Sample Date	Sample Type	Benzene (ug/m3)	Ethylbenzene (ug/m3)	Naphthalene (ug/m3)	Toluene (ug/m3)	Xylene (total) (ug/m3)
<b>Site-Specific Air SL (1E-04)</b>			<b>110</b>	<b>7100</b>	<b>42</b>	<b>7000</b>	<b>560</b>
<b>Site-Specific Air SL (1E-05)</b>			<b>110</b>	<b>710</b>	<b>42</b>	<b>7000</b>	<b>560</b>
<b>Site-Specific Air SL (1E-06)</b>			<b>23</b>	<b>71</b>	<b>5.2</b>	<b>7000</b>	<b>560</b>
FAM01	11/24/2014	SUMMA	0.4	< 0.09	< 0.2	1.1	< 0.19
FAM02	11/24/2014	SUMMA	0.74	0.55	< 0.2	0.9	0.73
FAM03	11/24/2014	SUMMA	3.16	6.4	7.2	3.6	6.4
FAM04	11/24/2014	SUMMA	0.54	0.5	1.2	0.59	0.5
FAM05	11/24/2014	SUMMA	0.44	< 0.09	< 0.2	0.4	< 0.19
QC01 (FAM04)	11/24/2014	SUMMA	0.57	0.5	< 0.17	0.75	0.59
<b>Average 9/9/14 - 11/24/14</b>			<b>2.33</b>	<b>2.77</b>	<b>2.75</b>	<b>2.59</b>	<b>3.53</b>

Notes:

- 1) Site-Specific Air Sample Levels (SL) were developed by Exponent and were provided in the *Site-Specific Perimeter Air Monitoring Acceptable Air Concentrations Technical Memorandum* June 4, 2014. SLs are based on acceptable air concentrations for target cancer risks.
- 2) Sample date listed is the start date of the 24-hour sampling period.
- 3) [REDACTED] Parameter level was below the method detection limit.
- 4) Averages do not include field blanks and duplicates.
- 5) Results below the method detection limit are average with the method detection limit level.
- 6) ug/m3 - micrograms per cubic meter adjusted to standard temperature and pressure.